


# EX40 EX41

- G(BSP) Maschi a macchina Scanalature elicoidali 45°
- G(BSP) Maschinen-Gewindebohrer, rechtsgedrahte Nuten 45°
- G(BSP) Machinetap met gespiraliseerde spaangroeven 45°
- G(BSP) Tarauds machine goujures hélicoïdales 45°

Fornito in HSS-E fino a nuovo stoc  
Lieferung in HSS-E bis neuer Lagerbestand verfügbar ist  
Geleverd in HSS-E tot de nieuwe voorraad beschikbaar is  
Fourni en HSS-E jusqu'à ce que le nouveau stock soit disponible

EX40	▪	1.1	1.2	1.3	1.4	1.5	7.1	7.2	7.3	7.4
	•	4.1	4.2	5.1	5.2	8.1				
EX41	▪	1.1	1.2	1.3	1.4	1.5	2.1	2.2		
	•	2.3								

EX40	G	DIN 5156	Normal		2.5XD	HSS-E PM	C 2-3	$\lambda 45^\circ$			
EX41	G	DIN 5156	Normal		2.5XD	HSS-E PM	C 2-3	$\lambda 45^\circ$		ST	

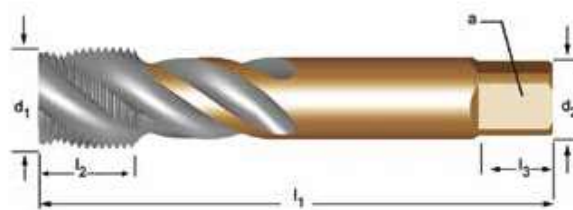

G(BSP)	TPI	d <sub>1</sub> nom mm	l <sub>1</sub> mm	l <sub>2</sub> mm	d <sub>2</sub> Ø mm	∇ a mm	l <sub>3</sub> mm	z		EX40	EX41
1/8	28	9.728	90	13	7.0	5.5	8	3	8.8	EX401/8	EX411/8
1/4	19	13.157	100	15	11.0	9.0	12	3	11.8	EX401/4	EX411/4
3/8	19	16.662	100	15	12.0	9.0	12	4	15.25	EX403/8	EX413/8
1/2	14	20.955	125	18	16.0	12.0	15	4	19.0	EX401/2	EX411/2
5/8	14	22.911	125	18	18.0	14.5	17	4	21	EX405/8	EX415/8
3/4	14	26.441	140	20	20.0	16.0	19	4	24.5	EX403/4	EX413/4
7/8	14	30.201	150	20	22.0	18.0	21	4	28.25	EX407/8	EX417/8
1"	11	33.249	160	22	25.0	20.0	23	4	30.75	EX401	EX411
1.1/8	11	37.897	170	22	28.0	22.0	25	4	35	EX401.1/8	EX411.1/8
1.1/4	11	41.910	170	22	32.0	24.0	27	4	39.5	EX401.1/4	EX411.1/4 <sup>1)</sup>
1.1/2	11	47.803	190	23	36.0	29.0	32	4	45	EX401.1/2	EX411.1/2 <sup>1)</sup>