
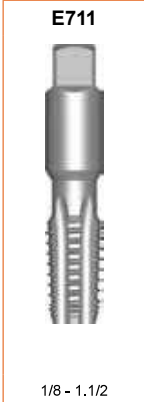


E711

- NPT Maschi a macchina, filettatura alternata Scanalature diritte
- NPT Maschinen-Gewindebohrer, ausgesetzte Zähne, geradenutet
- NPT Machinetap met rechte spaangroeven en onderbroken vertanding
- NPT Tarauds machine Goujures droites

E711 ■ 1.3 1.4
 • 1.1 1.2 1.5 3.1 3.2 3.3 3.4 6.2 7.3 7.4 8.1

E711 NPT ANSI B94.9 Normal 1.5XD HSS C 2-3

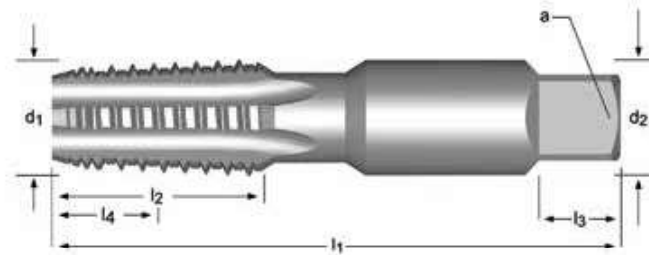

| NPT | TPI | d ₁ nom mm | l ₁ mm | l ₂ mm | l ₄ mm | d ₂ Ø mm | ∠ a mm | l ₃ mm | z | ↔ | E711 |
|-------|------|-----------------------|-------------------|-------------------|-------------------|---------------------|--------|-------------------|---|------|-----------|
| 1/8 | 27 | 10.29 | 70 | 19 | 11.9 | 11.1 | 8.3 | 10 | 5 | 8.5 | E7111/8 |
| 1/4 | 18 | 13.72 | 75 | 27 | 17.6 | 14.3 | 10.7 | 11 | 5 | 11.0 | E7111/4 |
| 3/8 | 18 | 17.15 | 80 | 27 | 19.5 | 17.8 | 13.5 | 13 | 5 | 14.5 | E7113/8 |
| 1/2 | 14 | 21.33 | 100 | 35 | 22.7 | 17.5 | 13.1 | 16 | 5 | 18.0 | E7111/2 |
| 3/4 | 14 | 26.67 | 105 | 35 | 24.4 | 23.0 | 17.2 | 17 | 5 | 23.0 | E7113/4 |
| 1" | 11.5 | 33.40 | 115 | 43 | 29.4 | 28.6 | 21.4 | 21 | 5 | 29.0 | E7111 |
| 1.1/2 | 11.5 | 48.26 | 135 | 43 | 28.9 | 38.1 | 28.6 | 25 | 7 | 44.0 | E7111.1/2 |